





BUILDING REPORT

- 1) UC Campus: [UCLA](#)
- 2) Building Name: [Rolfe Hall-Classroom Wing](#)
- 3) Building CAAN ID: [4216](#)
- 4) Auxiliary Building ID¹: [4216.2](#)

- 5) Date of Evaluation: [October 30, 2020](#)
- 6) Evaluation by (Firm, Evaluator Name, Signature, Stamp): [John A. Martin & Associates, Inc., JJ, JL](#)
- 7) Seismic Performance Rating² and Basis of Rating: [V, University of California Seismic Safety Policy and ASCE 41-17 Tier 1 evaluation. The brick masonry wall along gridline Hb, between gridliens 6 and 7 discontinues at the first floor level, and some shear wall segments exceed the stress limits per the Tier 1 requirements for concrete and reinforced masonry walls. A rating level V is given based on the anticipated structural performance of the building. A Tier 2 analysis is recommended to confirm the seismic performance rating.](#)

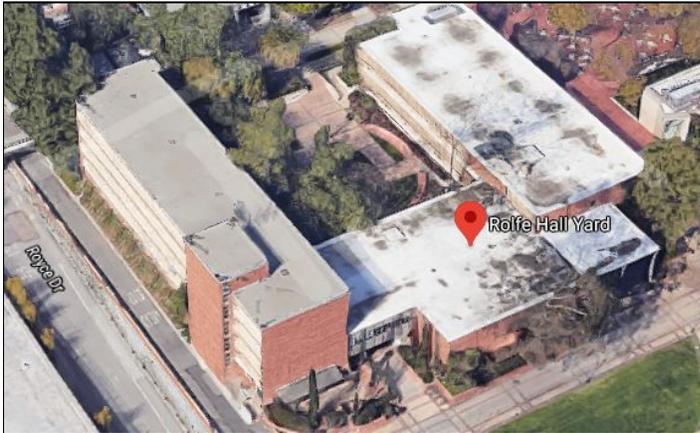

8) Plan Image or Aerial Photo

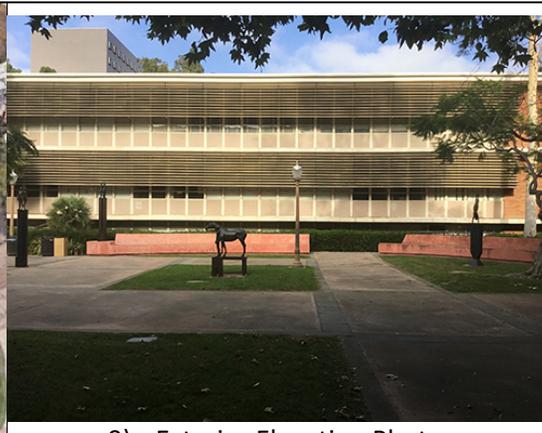

9) Exterior Elevation Photo

10) Site Location

- (a) Latitude Decimal Coordinates: [34.07](#)
- (b) Longitude Decimal Coordinates: [-118.44](#)

11) ASCE 41-17 Model Building Type and Description³

- (a) Longitudinal Direction: [Building Type C2 \(Concrete Shear Walls with Stiff Diaphragms\) and RM2 \(Reinforced Masonry Shear Walls with Stiff Diaphragms\)](#)
- (b) Transverse Direction: [Building Type C2 \(Concrete Shear Walls with Stiff Diaphragms\) and RM2 \(Reinforced Masonry Shear Walls with Stiff Diaphragms\)](#)

¹ Applicable only for individual buildings that are structurally separate units within a building complex. Each auxiliary building shall be designated with the main building CAAN ID with a decimal number suffix (i.e. main building CAAN ID 5534; auxiliary building CAAN ID 5534.1). Auxiliary building ID is null for a single building or the main building in a building complex.

² The designated Seismic Performance Rating shall be a Roman numeral associated with the most applicable performance description from Table 1 of the UC Facilities Manual, UC Seismic Program Guidelines.

³ If a building has multiple building types in one story, the model building type should be designated based on engineering judgement as the lateral system that would have the most predominantly negative effect on the seismic behavior of the building in that respective direction.



Rolfe Hall is comprised of three seismically separated structures – the Office Wing, the Classroom Wing, and the Center Portion. The Classroom Wing is separated from the Center Portion with a 3” seismic joint. The gravity structural system of the Classroom Wing consists of 9-inch flat slabs supported by rectangular HSS steel columns spaced at 23 feet 4 inches on center in the north-south direction and 21 feet 8 inches or 12 feet 2 inches on center in the east-west direction. The lateral load resisting system consists of 9-inch brick masonry walls and 8-inch gunite concrete walls in both orthogonal direction of the building. There is a 11½-inch concrete wall along the east elevation from the ground level to the first floor level. Perimeter shear walls are supported on continuous wall footings and the interior shear walls are supported on deep grade beams with depths ranging from 5’-8” to 6’-6”. Columns are supported on conventional spread footings.

12) Number of Stories

- (a) Above grade: 3
- (b) Below grade: 0

13) Original Building Design Code & Year: [Uniform Building Code 1952](#)

14) Retrofit Building Design Code & Year (if applicable): [Not Applicable](#)

15) Cost Range to Retrofit (if applicable)⁴ (Low, Medium, High, or Very High): [Low](#)

Please assume a “Low” cost-range corresponds to a complete retrofit cost less than \$50 per square foot (sf), a “Medium” cost-range corresponds to a complete retrofit cost greater than \$50 per sf and less than \$200 per sf, a “High” cost-range corresponds to a complete retrofit cost greater than \$200 per sf and less than \$400 per sf, and a “Very High” cost-range corresponds to a complete retrofit cost greater than \$400 per sf.

⁴ Assume a complete retrofit conforming to the current UC Seismic Safety Policy. Note this range includes all construction costs, including code upgrades (e.g., accessibility, fire and life safety, mechanical, electrical, plumbing) triggered by the seismic retrofit. No specific estimate is required to be supplied at this time (i.e., provide an approximate cost to retrofit using Low, Medium, High or Very High cost-range categories). It is acknowledged that such a cost range is assumed to be based only on the engineer’s rough estimate and is not intended to require input from a professional cost estimator. For estimation purposes, CSEs may judgmentally determine an approximate cost range for seismic retrofits based on recent relevant experience, and then apply a multiplier to approximate total construction costs.



BACKGROUND INFORMATION

Site Information

16) Site Class (A – F) and Basis of Assessment: [Site Class D \(default site class per code; no geotechnical reports available\)](#)

17) Geologic Hazards

- (a) Fault Rupture (Yes, No or Unknown) and Basis of Assessment: [No, based on “Fault Activity Map of California” from California Geological Survey.](#)
- (b) Liquefaction (Yes, No or Unknown) and Basis of Assessment: [No, based on “Earthquake Zones of Required Investigation Beverly Hills Quadrangle” map published by the California Geological Survey, dated January 11, 2018.](#)
- (c) Landslide (Yes, No or Unknown) and Basis of Assessment: [No, based on “Earthquake Zones of Required Investigation Beverly Hills Quadrangle” map published by the California Geological Survey, dated January 11, 2018.](#)

18) Site-specific Ground Motion Study? (Yes or No): [No](#)

Seismic design acceleration parameters of interest:	
For BSE-2E	S_{XS}: 1.861g S_{X1}: 0.948g
For BSE-1E	S_{XS}: 0.898g S_{X1}: 0.517g

19) Estimated Fundamental Period (seconds)

- (a) Longitudinal
Classroom Wing: [0.29sec](#)
- (b) Transverse
Classroom Wing: [0.29sec](#)

20) Falling Hazards Assessment Summary: [A structural observation could not be conducted as the campus is currently closed due to the Covid-19 pandemic. Based on the record architectural drawings, the precast roof coping overhanging around the perimeter of the roof is reinforced with light mesh and anchored to the roof slab with ½” diameter expansion bolts at 3’-0” on center spacing. The minimal reinforcing and anchorage may result in localized spalling and may present a falling hazard.](#)

21) Structural Non-Compliances/Findings Significantly Affecting Rating Determination Summary
Significant Structural Deficiencies, Potentially Affecting *Seismic Performance Rating* Designation:

- (a) [Adjacent Buildings](#)
[The separation between the office wing and center portion of Rolfe Hall is 3-inches per the structural drawings \(reference sheet S-3\). This is less than the required clear distance per the Tier 1 checklist. A 3D analysis model and Tier 2 evaluation may show that the existing seismic joint is sufficient to accommodate the relative displacement between the adjacent structures.](#)



(b) Geometry (vertical irregularities)

Classroom Wing: An in-plane shear wall vertical irregularity occurs at the brick masonry shear wall along Gridline Hb from the ground floor to first floor level.

(c) Torsion

Classroom Wing: The estimated distance between the center of mass and center of rigidity along both orthogonal directions of the building at the first and second floor levels are greater than the permissible distance per the Tier 1 checklist.

(d) Shear Wall Stress Checks

The average shear stress in some of the brick masonry and concrete shear walls in both orthogonal directions of the building exceed the shear stress limit per the Tier 1 checklist. A Tier 2 evaluation may eliminate some of these deficiencies and show that the existing walls meet the required acceptance criteria.

(e) Openings at Shear Walls (concrete or masonry)

Diaphragm openings adjacent to Stair No. 1 and Stair No. 2 are greater than 25% of the length of shear walls adjacent to the openings.

22) Brief Description of Anticipated Failure Mechanism

Select concrete and masonry walls may experience in-plane shear failure during a seismic event. Inherent torsion and vertical irregularities may contribute to higher stresses in the shear walls.

23) Seismic Retrofit Concept Sketches/Description (only required for buildings rated V or worse)

Strengthen the deficient shear walls using fiber reinforced polymer (FRP) wrap or shotcrete. Reinforce deficient wall jambs supporting discontinuous shear walls by jacketing the existing jamb section with concrete or wrapping with layers of FRP to confine the existing concrete to provide additional axial strength.

Building Report Appendices

- A) ASCE 41-17 Tier 1 Checklists (Structural only)
- B) Quick Check Calculations