

Date: 04/16/2021

CERTIFICATE OF SEISMIC PERFORMANCE RATING

UC-Designed & Constructed Facility

Campus-Acquired or Leased Facility

BUILDING DATA

Building Name: Ostin Basketball Center - MEP Auxiliary Address: 440 Charles E Young Drive West, Los Angeles, CA 90024 Site location coordinates: Latitude 34.06934 Longitudinal -118.44823

UCOP SEISMIC PERFORMANCE RATING (OR "RATING"): III

ASCE 41-17 Model Building Type:

- a. Longitudinal Direction: C2: Reinforced Concrete Shear Walls (CAAN ID: 42121.1)
- b. Transverse Direction: C2: Reinforced Concrete Shear Walls (CAAN ID: 42121.1)

Gross Square Footage: 1,000 Number of stories *above* grade: 2 Number of basement stories *below* grade: 0

Year Original Building was Constructed: 2017 Original Building Design Code & Year: CBC-2013 Retrofit Building Design Code & Code (if applicable): N/A, N/A

SITE INFORMATION

Site Class: DBasis: (Geocon West, Inc., 06.18.2014, Reference Page No: 7)Geologic Hazards:Fault Rupture: NoBasis: Geotechnical ReportLiquefaction: NoBasis: Geotechnical ReportLandslide: NoBasis: Geotechnical Report

ATTACHMENT

Original Structural Drawings: (UCLA Basketball Facility-Phase 2B, SEOR: Thornton Tomasetti, 03.23.2016, S0-01 [General Notes of Structural Sheet showing Code Design Year]) or
Seismic Evaluation: (N/A, N/A, N/A, N/A)
Retrofit Structural Drawings: (N/A, N/A, N/A, N/A)



UNIVERSITY OF CALIFORNIA

Date: 04/16/2021

CERTIFICATION & PRESUMPTIVE RATING VERIFICATION STATEMENT

I, Bruce Gibbons, a California-licensed structural engineer, am responsible for the completion of this certificate, and I have no ownership interest in the property identified above. My scope of review to support the completion of this certificate included both of the following ("No" responses must include an explanation):

- a) the review of structural drawings indicating that they are as-built or record drawings, or that they otherwise are the basis for the construction of the building: ☑ Yes □ No
- b) visiting the building to verify the observable existing conditions are reasonably consistent with those shown on the structural drawings: ☑ Yes □ No

Based on my review, I have verified that the UCOP Seismic Performance Rating is presumptively permitted by the following UC Seismic Program provision (choose one of the following):

☑ 1) Contract documents indicate that the original design and construction of the aforementioned building is in accordance with the benchmark design code year (or later) building code seismic design provisions for UBC or IBC listed in the Benchmark Building Codes and Standards table below.

□ 2) The existing rating is based on an acceptable basis of seismic evaluation completed in 2006 or later.

□ 3) Contract documents indicate that a comprehensive¹ building seismic retrofit design was fullyconstructed with an engineered design based on the 1997 UBC/1998 *or later* CBC, and (choose one of the following):

□ the retrofit project was completed by the UC campus. Further, the design was based on ground motion parameters, at a minimum, corresponding to BSE-1E (or BSE-R) and BSE-2E (or BSE-C) as defined in ASCE 41, or the full design basis ground motion required in the 1997 UBC/1998 CBC *or later* for EXISTING buildings, and is presumptively assigned a rating of IV.

□ the retrofit project was completed by the UC campus. Further, the design was based on ground motion parameters, at a minimum, corresponding to BSE-1 (or BSE-1N) and BSE-2 (or BSE-2N) as defined in ASCE 41, or the full design basis ground motion required in the 1997 UBC/1998 *or later* CBC for NEW buildings, and is presumptively assigned a rating of III.

□ the retrofit project was not completed by the UC campus following UC policies, and is presumptively assigned a rating of IV.

¹ A comprehensive retrofit addresses the entire building structural system as indicated by the associated seismic evaluation, as opposed to addressing selective portions of the structural system.

This certificate is to be used in connection with the UC Facilities Manual, UC Seismic Program Guidelines.

Campus: Westwood Building Name: Ostin Basketball Center - MEP Aux CAAN ID: 42121 Auxiliary Building ID: 42121.1



UNIVERSITY OF CALIFORNIA

Date: 04/16/2021

CERTIFICATION SIGNATURE

Bruce Gibbons Print Name

Managing Principal Title

License Expiration Date

April 16, 2021

AFFIX SEAL HERE

S4160


CA Professional Registration No.

Signature

Date Thornton Tomasetti, 1-213-330 7000

707 Wilshire Blvd, Ste 4450, Los Angeles, CA 90017

Firm Name, Phone Number, and Address

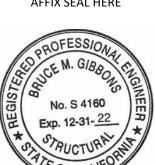



Benchmark Building Codes and Standards

Building Type ^{a, b, j}	Building Seismic Design Provisions	
	UBC	IBC
Nood frame, wood shear panels (Types W1 and W2)	1976	2000
Nood frame, wood shear panels (Type W1a) ^j	1976 ^j	2000
Steel moment-resisting frame (Types S1 and S1a) ^{<i>j</i>}	1997 ^j	2000
Steel concentrically braced frame (Types S2 and S2a)	1997	2000
Steel eccentrically braced frame (Types S2 and S2a)	1988 ^g	2000
Buckling-restrained braced frame (Types S2 and S2a)	f	2006
letal building frames (Type S3)	f	2000
Steel frame with concrete shear walls (Type S4)	1994	2000
Steel frame with URM infill (Types S5 and S5a)	f	2000
Steel plate shear wall (Type S6)	f	2006
Cold-formed steel light-frame construction—shear wall system (Type CFS1)	1997 ^{<i>h</i>}	2000
Cold-formed steel light-frame construction—strap-braced wall system (Type CFS2)	f	2003
Reinforced concrete moment-resisting frame (Type C1)	1994	2000
Reinforced concrete shear walls (Types C2 and C2a)	1994	2000
Concrete frame with URM infill (Types C3 and C3a)	f	f, j
ilt-up concrete (Types PC1 and PC1a)	1997	2000
recast concrete frame (Types PC2 and PC2a)	f	2000
Reinforced masonry (Type RM1)	1997	2000
teinforced masonry (Type RM2)	1994	2000
Inreinforced masonry (Type URM) ^j	f	f, j
Inreinforced masonry (Type URMa) [/]	f	f, j
eismic isolation or passive dissipation	1991	2000

Note: This table has been adapted from ASCE 41-17 Table 3-2. Benchmark Building Codes and Standards for Life Safety Structural Performed at BSE-1E. Note: UBC = Uniform Building Code

Note: IBC = International Building Code

a Building type refers to one of the common building types defined in Table 3-1 of ASCE 41-17.

b Buildings on hillside sites shall not be considered Benchmark Buildings.

c not used

d not used

e not used

f No benchmark year; buildings shall be evaluated in accordance with the UC Seismic Safety Policy and the UC Seismic Program Guidelines.

g Steel eccentrically braced frames with links adjacent to columns shall comply with the 1994 UBC Emergency Provisions, published September/October 1994, or subsequent requirements.

h Cold-formed steel shear walls with wood structural panels only.

i Flat slab concrete moment frames shall not be considered Benchmark Buildings.

j Shaded cells are intentionally modified from ASCE 41-17 Table 3-2.